


Readjustment Procedures to Reduce Input Current to 15Amps

Document Request DR001

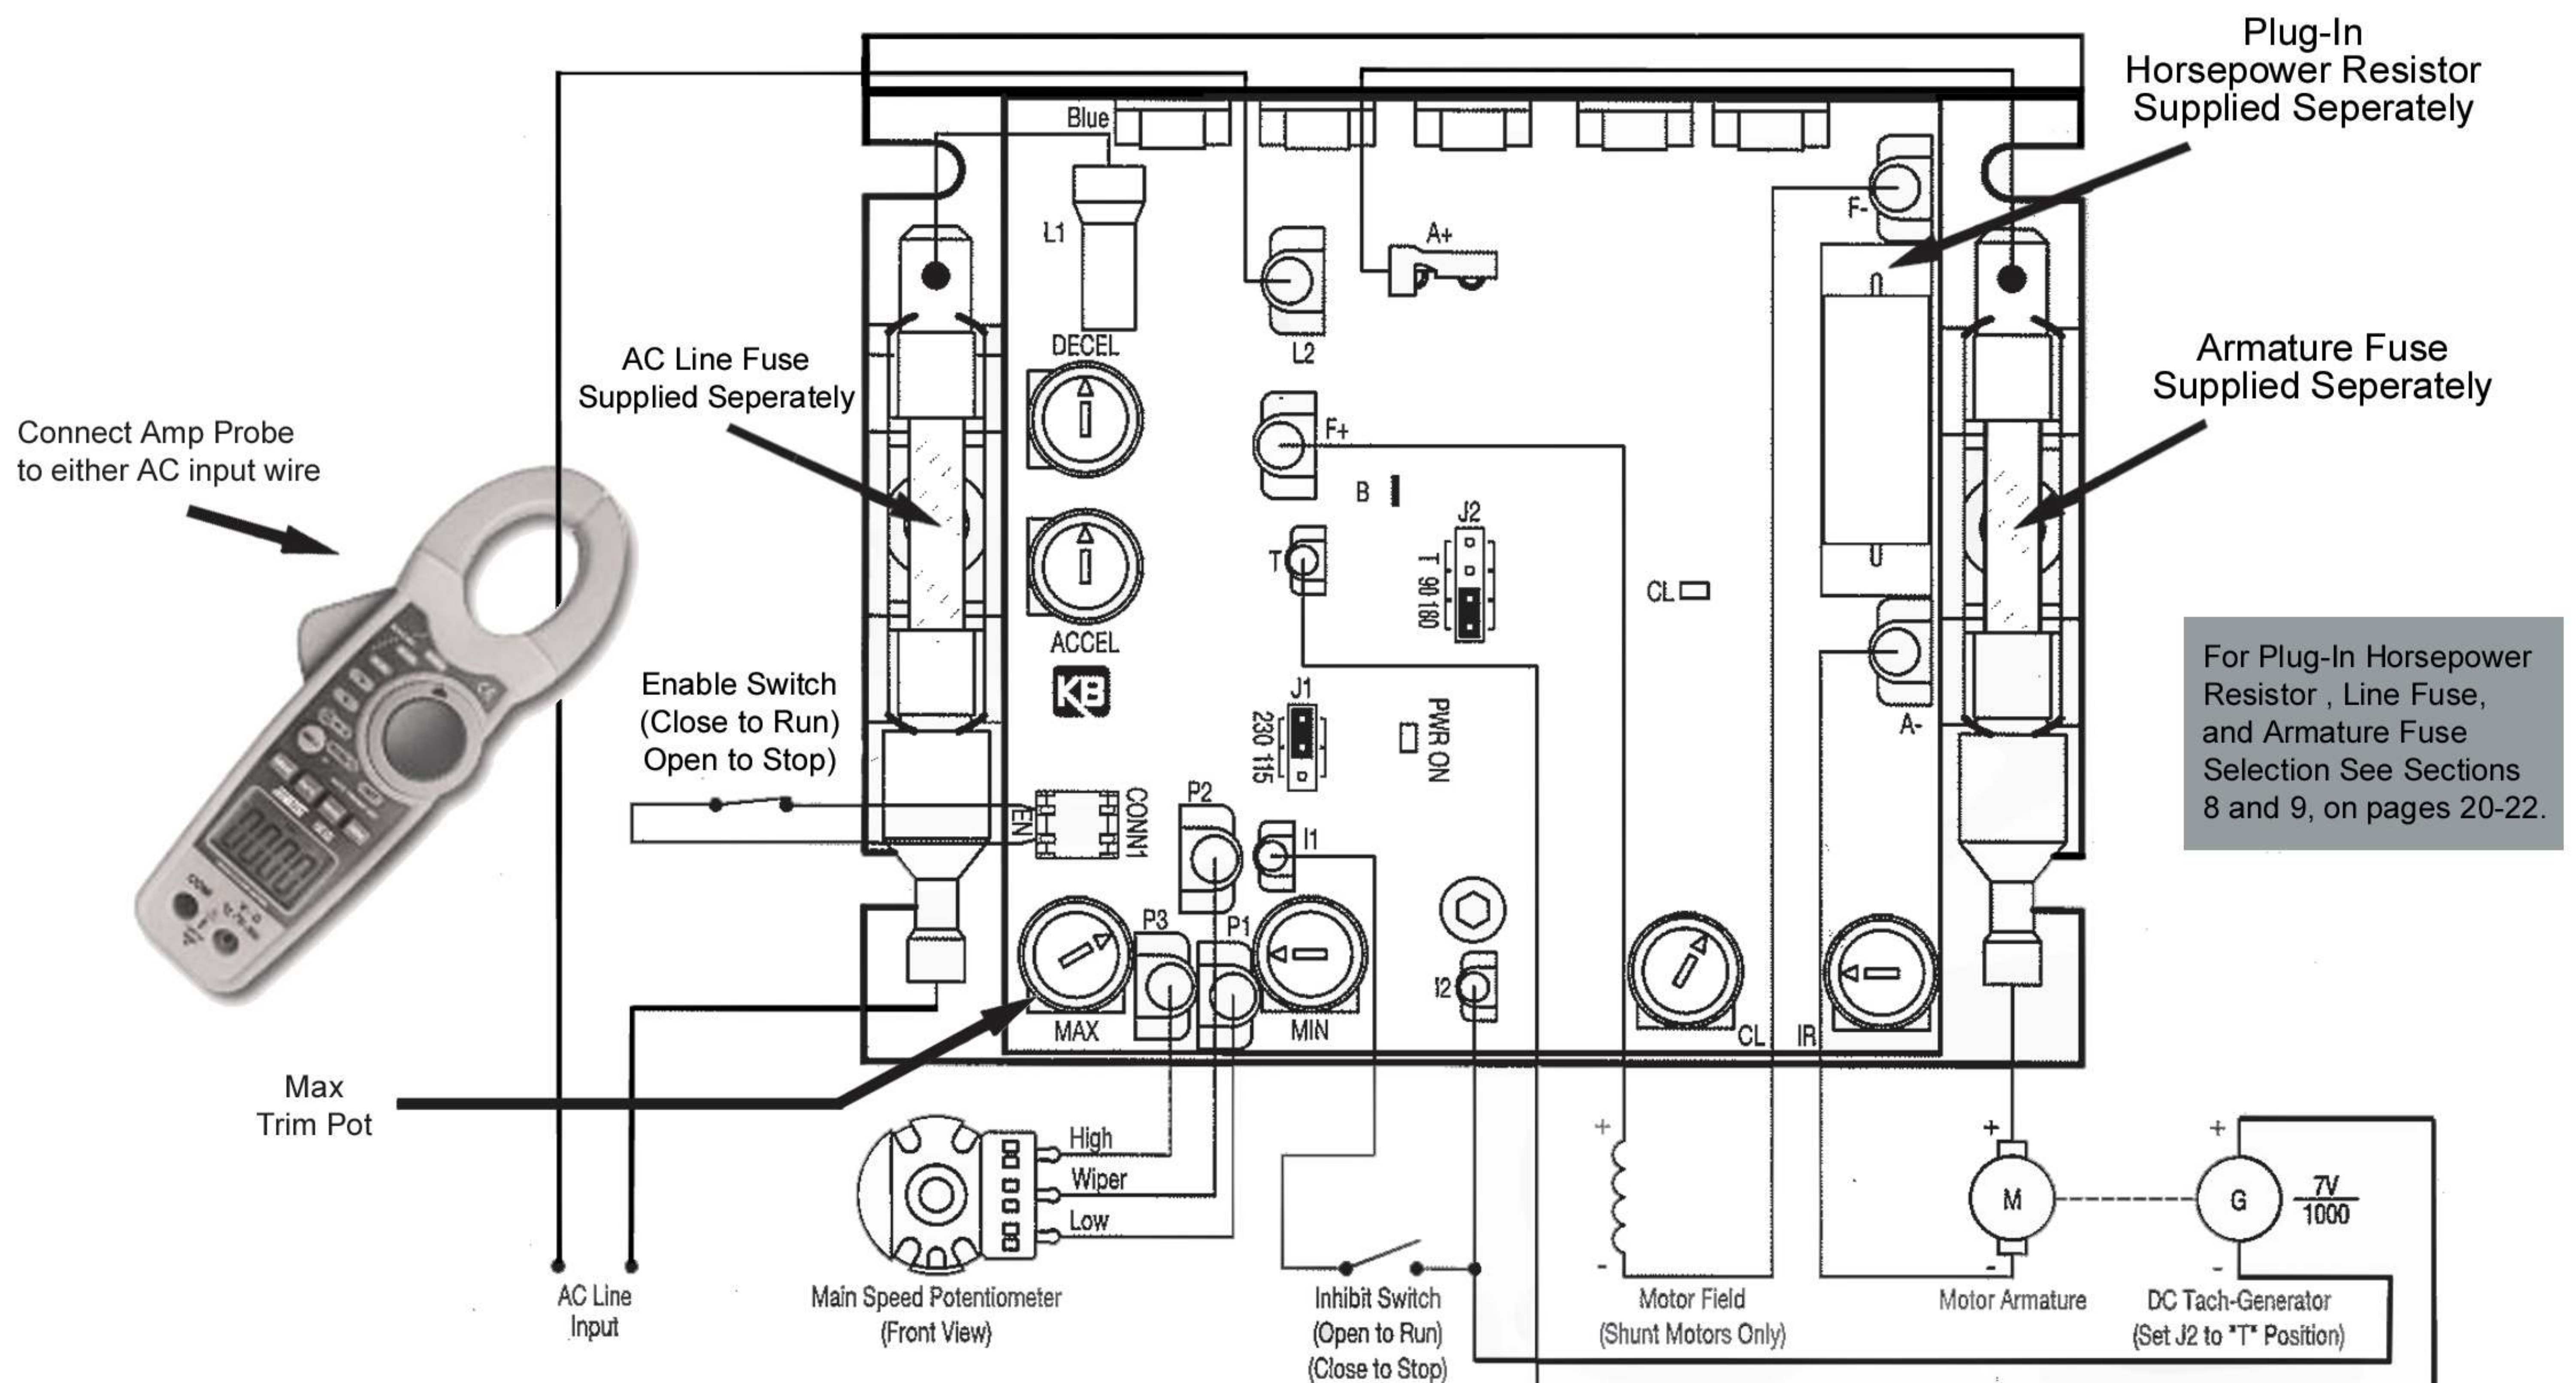

1. Attach AC Amp probe to AC side of controller as shown above.
2. Start fan with speed knob on the control panel set to minimum. AC current should be about 2-3 Amps.
3. Adjust speed knob on the control panel for maximum speed.
4. Adjust the max trim pot on the control board for 13.5 Amps while motor is cold.
NOTE: Max current will rise about 1.5 Amp (from 13.5 to 15 Amp) as motor warms-up.